


Parts List for Morse Pump Power Pack - Part # M3500-P

ITEM	QTY	PART #	DESCRIPTION
1	1	M12748-P	BASE ASM, M4507, STD MTR MNT
2	1	M12171-200-P	PUMP ASM, DC
3	4	M07819-P	SHCS, 1/4-20 X 2-3/4, MON
4	1	M01490-P	CONNECTOR ASM, BRASS 1/2TX3/8
5	1	M13021-1050-P	TUBE, RETURN, 45 DEG, 1/8 NPTF
6	1	M04297-08-P	TUBE, SUCTION, 45 DEG 1/2 ALUM
7	1	M01315-P	FILTER, SUCTION, MON
8	2	M01073-P	CLAMP, CABLE TIE, 1/16-1.75D
9	1	M01319-P	ADAPTER, PUMP VALVE, 3-3/8
10 *	1	M10803-P	HANDLE ASM, MANUAL RELEASE
11	1	M10802-P	VALVE, MANUAL, 2W/2P, NC
12	1	M01290-P	BRACKET, 2 TOGGLE SWITCH
13	1	M04196-P	FIT, ELBOW, 90 DEG, PIPE STL
14	1	M01487-P	ELBOW, COMP, STL, 90 3/8TX1/4
15	1	M03208-P	SWITCH, PUSH BUTTON, MOMENTARY
16	1	M07767-P	VALVE, MANUAL, 2W/2P, NC
17	1	M11012-P	VALVE ASM, CMP, 7/W, 4/W RD
18	2	M03578-P	FIT, ELBOW, 90 DEG, COMP, 3/8
19	1	M13151-P	TUBE, RETURN, 180 DEG
20	1	M01488-P	CONNECTOR ASM, 3/8T X 1/4
21	1	M08111-P	MOTOR, DC, 12V, 4.5", 1 TERM
22	1	M17744-P	SWITCH, SOLENOID, 12V DC
23	1	M13155-P	STRAP, MOTOR-SOLENOID
24	2	M07587-P	SCREW, HEX, WASHER, SERRATED
25	1	M04618-P	RESERVOIR, POLY, 4.5 X 12
26	1	M03171-P	PLUG, BREATHER, 3/8 NPT
27	1	M07900-P	CLAMP, HOSE, WORM GEAR, RSV
28	1	M07550-07-P	WIRE ASM, CONTROL, 16 AWG, HS
29	1	M13190-08-P	WIRE ASM, CONTROL, 1/4F 5/16
30	1	M13191-08-P	WIRE ASM, CONTROL, 1/4F #10
31	1	MTUB-044-P	TUBING, NYLON, 3/8 OD, .093W
32	1	M01080-P	NIPPLE, MALE PIPE, HEX 1/4-18
33	1	M01028-.75-P	VALVE ASM, PCFC, .75 GPM
34	1	M01085-P	BUSHING, REDUCER, 1/4M X 1/8F
35	1	M13021-5.5-P	TUBE, RETURN, 45 DEG 1/8 NPTF
36 *	2	M01157-P	BALL, PLASTIC, HANDLE, MON
37 *	2	M01326-P	ROD, VALVE HANDLE, MON
* Recommended spare parts.			

Parts Diagram for Morse Pump Power Pack - Part # M3500-P

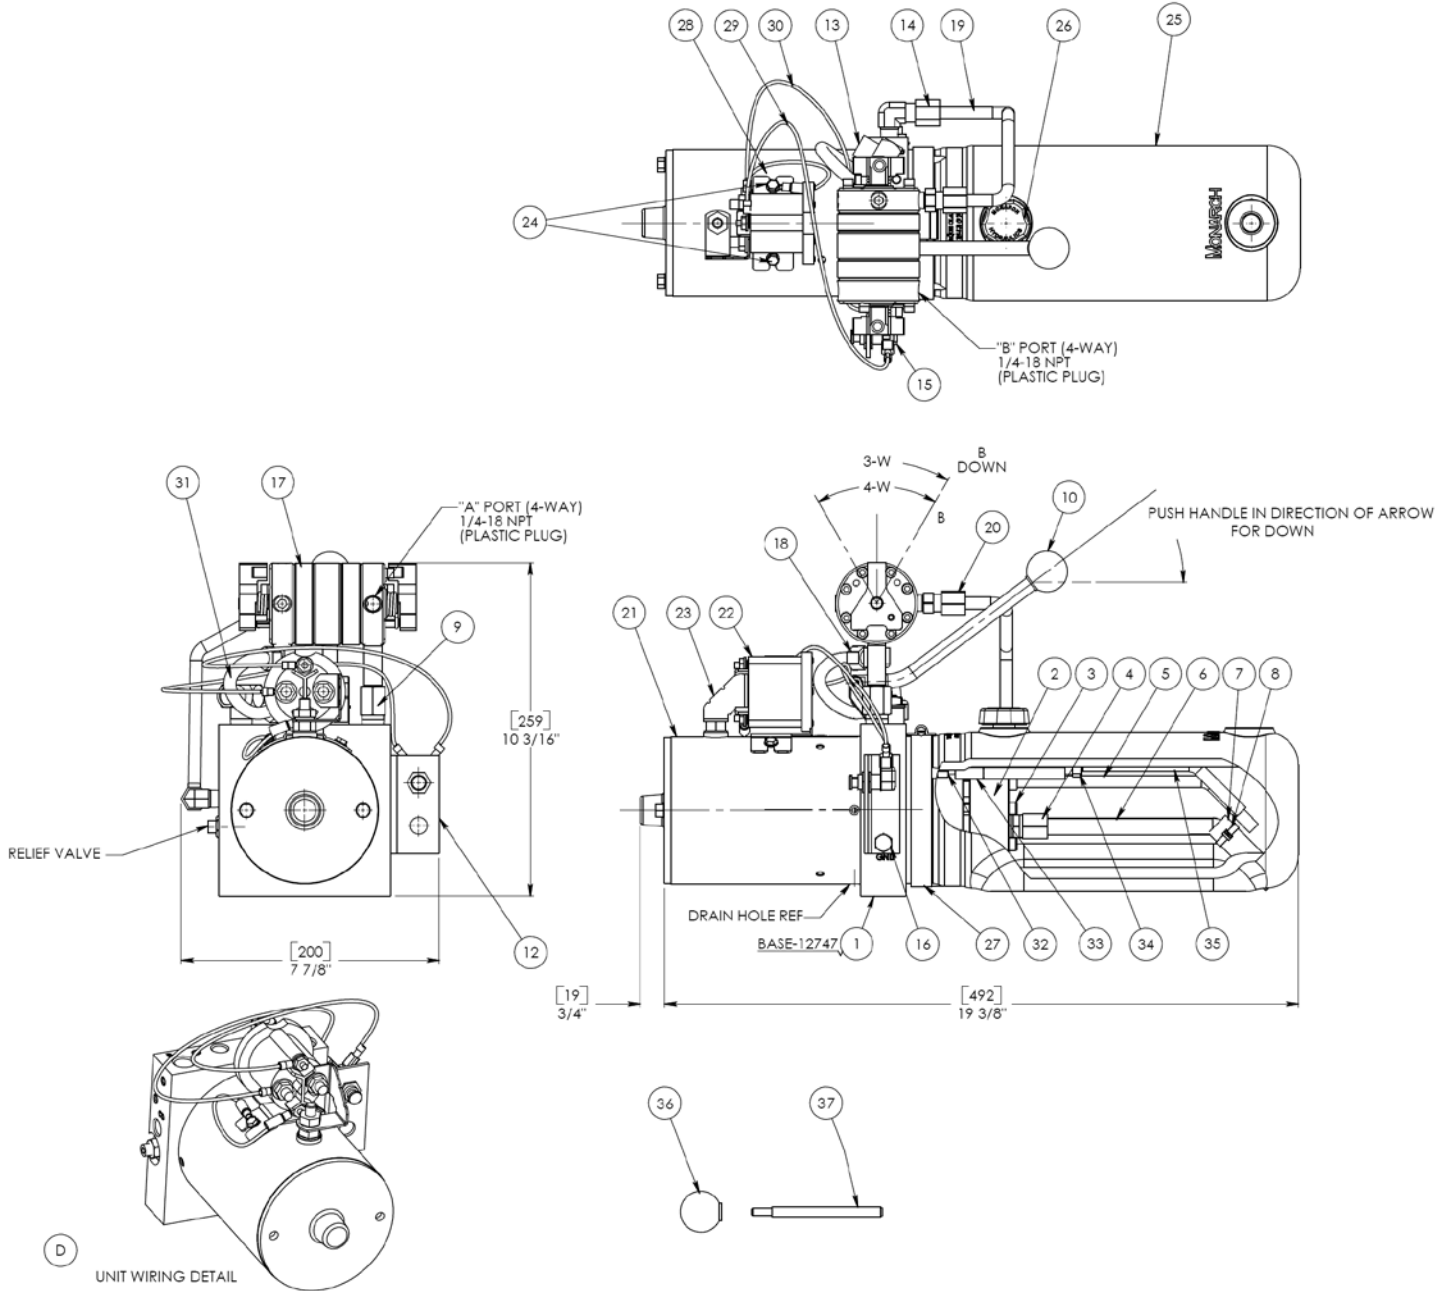

Schematic for Morse Pump Power Pack - Part # M3500-P

